Three Rivers Park District

Repair Order History - Details

Repair Order # SYS40468 Unit: 2217 - SD (Trucks) Page: 15 of 111

8/29/2017 2:27:43 PM

Central Standard Time

Unit: 2217 - SD (Trucks)				Repair Order # SYS40468		
Date / Time (In-Out)		Status	Repair Class	Serial Number	License	Meter Reading(s)
Date In:	12/7/2015	CLOSED	Outside Repair	1FDWF37F82ED13366	939-400	73,702 Miles
Date Out:	12/15/2015				•	
Time In:	7:29 AM	Location	Repair Stage	Mechanic/Vendor		
Time Out:	7:29 AM	ND		Ernhart's Auto Center		-
Cost Date:	12/7/2015					

Mechanic Instructions / Complaints

PM SERVICES

PM Name || Last Performed || Status || Detail

C-PM -- 12/4/2014 -- OVERDUE -- 13 Days Overdue.

External Work

Ernhart's Auto Center

Date: 12/7/2015

Billing Method:

Status: Unpaid

Purchased By: LEE

Page: 16 of 111

8/29/2017 2:27:43 PM Central Standard Time

Notes: CONCERN #1 - CHECK ENGINE

LIGHT COMES ON ON A HARD

ACCEL

CORRECTION - PERFORMED A SCAN TEST, FOUND CODES P1298 & P1283. PID MONITOR. PIN-POINT TEST AS NECESSARY. REPLACED THE INJECTOR DRIVER MODULE. RE TESTED THE SYSTEM - CODE IS GONE.

CONCERN #2 - FUEL IN THE COOLANT CORRECTION - CHECKED FOR THE CONCERN. REMOVED ALL INJECTORS, PRESSURE TESTED THE SYSTEM AND CHECKED FOR THE LEAK. FOUND CRACKED CYLINDER HEAD. REMOVED COMPONENTS AS NECESSARY, REPLACED BOTH CYLINDER HEADS, REPLACED ALL INJECTOR ORINGS, REPLACED ALL OF THE EXHAUST MANIFOLD TO CYLINDER HEAD BOLTS, AND REPLACED PARTS AS NECESSARY TO COMPLETE THE REPAIR. REPLACED THE COOLANT DEGAS TANK, FLUSHED THE COOLING SYSTEM SEVERAL TIMES, REASSEMBLED, CHANGED THE OIL/FILTER, **RECHECKED SEVERAL TIMES -**OK.

CONCERN #3 - OIL LEAK. CORRECTION - REPLACED THE TURBO PEDESTAL UNDER WARRANTY.

Copy of this invoice can be found attached to the hard copy of this RO or as a PDF under the documents

Invoice #: 8299

	VMRS Code: 040-000-000 Engine / Motor Systems G	roup			
	Repair Reason: Breakdown				
	Failure Code:				can a transferance
W	/ork Description:				
Work Accomp	olished Item		Cost	Tax Cost	Total Cost
Labor:	LABOR		\$2,597.00	\$0.00	\$2,597.00
	To	otal Labor:	\$2,597.00	\$0.00	\$2,597.00
Parts:	ENVIRONMENTAL FEE		\$1.00	\$0.00	\$1.00
	(3) #12 HOSE CLAMP		\$2.85	\$0.20	\$3.05
	THERMOSTAT GASKET		\$6.63	\$0.46	\$7.09
	SHOP SUPPLIES		\$9.75	\$0.00	\$9.75
	(2) PLUG		\$12.24	\$0.84	\$13.08
	COOLING SYSTEM CLEANER		\$13.99	\$0.96	\$14.95

Repair Order History - Details

Page: 17 of 111

Central Standard Time

8/29/2017 2:27:43 PM

Total Part:	\$3,451.57	\$232.24	ψο,οσο.οτ
		# 000 04	\$3,683.81
YLINDER HEAD	\$1,650.00	\$113.44	\$1,763.44
RIVER MODULE	\$425.89	\$29.28	\$455.17
SKET	\$228.50	\$15.71	\$244.21
VER GASKET	\$159.34	\$10.95	\$170.29
R O-RING KIT	\$130.80	\$8.99	\$139.79
OLT .	\$128.16	\$8.81	\$136.97
OOLANT	\$76.50	\$5.26	\$81.76
ESEVOIR	\$76.24	\$5.24	\$81.48
ROTELLA OIL	\$75.65	\$5.20	\$80.85
	\$64.85	\$4.46	\$69.31
S AND PIGTAIL CONNECTOR	\$62.75	\$0.00	\$62.75
T MANIFOLD TO HEAD BOLT	\$54.72	\$3.76	\$58.48
MBLY	\$46.10	\$3.17	\$49.27
DIPSTICK	\$36.22	\$2.49	\$38.71
NUT	\$32.08	\$2.21	\$34.29
OW .	\$31.58	\$2.17	\$33.75
NG ORING KIT	\$27.88	\$1.92	\$29.80
PIN	\$23.00	\$1.58	\$24.58
JOLI	\$20.76	\$1.43	\$21.03
BOLT	\$19.41 \$19.68	\$1.35	\$20.74
AT	,	ŕ	\$16.03 \$20.74
		·	T \$19.41 \$1.33

Schmit Towing, Inc

Date: 12/7/2015

Billing Method:

Status: Unpaid Purchased By: Nate

Notes: Tow charge. Networkfleet covered the first 25 miles.

Invoice #: 34284

	VMRS Code: T80-000-000 Towing				
	Repair Reason: Breakdown				
	Failure Code:				
	Work Description:				
	Work Accomplished Item		Cost	Tax Cost	Total Cost
Labor:			\$85.00	\$6.61	\$91.61
		Total Labor:	\$85.00	\$6.61	\$91.61
Total:	T80-000-000 Towing	•	\$85.00	\$6.61	\$91.61

\$6,372.42 Total R/O Cost